


new serie

Quick change SDS converter for regular percussion power tools

New serie with 1/2" square drive

This adapter, mounted on an electric or pneumatic tool with a 1/2 " square drive allows use of SDS drill bits. Furthermore the RACSDSIH special adapter allows the drill to become a screwdriver. The replacement of the SDS bit occurs very easily through a spring ring sliding on the spindle axis. In fact, by gripping the ring, the weight of the drill opens the hooking device.


All the spindle components are made of treated steel.

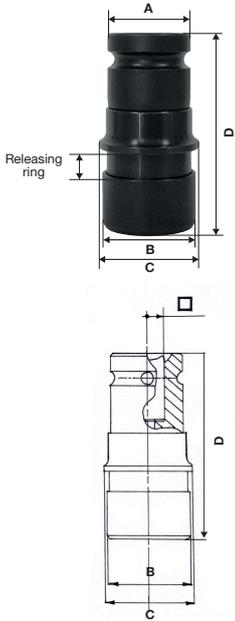

Model No.	Power tool nose	A mm	B mm	C mm	D mm	Packaging style	Weight g
SDSCONV	Dr 1/2" Square	25	28	30	58	Individual box	160
SDSCONVB						Blister card	

DIFFERENT WAYS OF APPLICATION

SDS QUICK RELEASE ADAPTOR



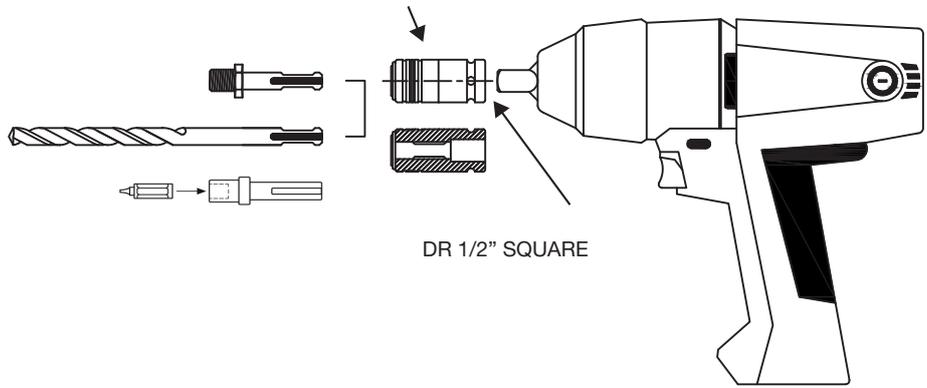


Drilling and screwing bits quick change holder set

Tool set includes 1/4" quick release chuck with 3/8" hexagon shank to be fitted in a power tool and three unique drill and drive bit combinations which enable easy and fast way to change tool for drilling hole and screwing.



Model No.	A mm	B mm	Packaging style	Weight g
DSTS	20.5	54	Blister card	90

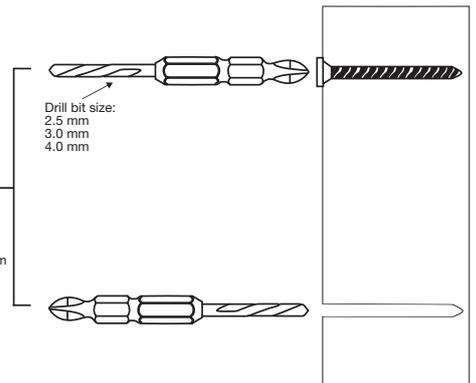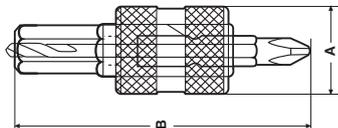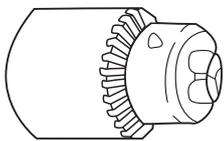

new serie

Rivet Converter

New Serie: Cast Aluminium body.

Simply convert the standard cordless, electric, pneumatic, drill/drive into a blind rivet gun.

Accept 3/8" and 1/2" (10/13mm) drill chuck or 1/4" (6.35mm) hex recess.

Compatible with 12V, 14.4V and 18V cordless drill/drive and any reversible corded drill I drive.

Pull: Aluminium rivets: 2.4-4.8mm

Stainless steel rivets: 2.4-4.0mm

Comes complete 2.4-3.2-4.0-4.8mm (3/32"-1/8"-5/32"-3/16") 4 nosepieces.

Max rpm: 1000 rpm.





The shank of rivet is expelled when the drill is operated in the "reverse" mode.

If used with a combination impact drill, ensure that it is set to drilling mode.



Model no.	Mount	Aluminium rivets size mm	Steel rivets size mm	Max Speed	Packaging style	Weight g
	1/4" DIN 3126 Form E 6.3	from 2,4 a 4,8	from 2,4 a 4,0	1000 rpm	Individual box	280

- ① Hexagon shank 1/4" Din 3126 Form E 6.3
- ② Housing: die cast aluminium
- ③ Nosepiece: mm 2.4 – 3.2 – 4.0 – 4.8
- ④ Sight window: Blind rivet loading
- ⑤ Wrench with interchangeable noses

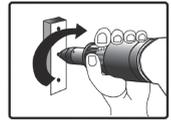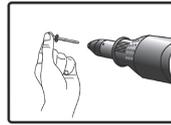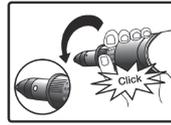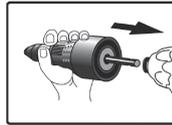

Chuck extender for portable drill

Hand drills are often limited in use by the bulk of the drill's body.

This 300mm chuck extender makes it possible to do many more things with a hand held drill by giving access to areas that would normally be unreachable.

The sliding aluminium handle on the chuck extender lets you apply greater lateral force on attachments with all the stress being absorbed by the extender, not the drill.

The Chuck Extender with hexagon 9 mm taper can be supplied with:


Key operated chuck , female thr. 3/8"-24UNF, capacity 1,5-10mm, with standard key DIN S14, Porta's model number AH10F38R

Model PMK

Keyless chuck, female thr. 3/8"-24UNF, capacity 1,5-10mm,

Porta's model number LD10F38R

Model PML

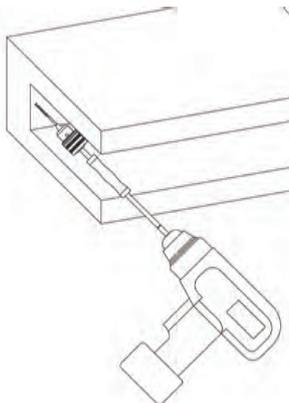

Model No.	Mount	Drilling Capacity mm	Key	Porta chuck	Weight g
PMK	3/8"-24 UNF	1,5-10	DIN S14	AH10F38R	400
PML	3/8"-24 UNF	1,5-10	-	LD10F38R	390



Flexible bit holder for screwdriver

With 1/4" hexagon Din 3126 E 6,3 driver for screwdrivers on one side and a quick change 1/4" hexagon bit holder on the other side

Model no.	Length mm	Max speed RMP	Max torque kgf/cm	Packaging	Weight g
RACFLEX 2	200	3000	165	Individual box	200
RACFLEX 3	300		135		300
RACFLEX 4	400		135		400



Flexible shaft with spring chuck

Available in two models: DIY and High Speed

Model no.	Length mm	Max speed RMP	Max torque kgf/cm	Packaging	Weight g
FS06DIY	1000	6000	Goodel 6mm	Individual box	700
FS06HS	1300	15000	Goodel 6mm	Individual box	900
FS10HS			Goodel 10mm		940



Quick clamping nut

TECHNICAL FEATURE: Suitable for grinding/cutting discs from 100 mm up to 230 mm and angle grinder power below 2400 W.

Easy tightening and release.


Available mount size: M14.

HOW TO INSTALL IT:

Place grinding/cutting wheel on spindle, making sure wheel is centered on flange. Place the Quick Clamping Nut onto spindle, rotate clockwise and lock (2-4 Nm).

HOW TO REMOVE IT:

Grip the outer ring of the Quick Clamping Nut by hand and release it counterclockwise from the grinder spindle (2-4 Nm).

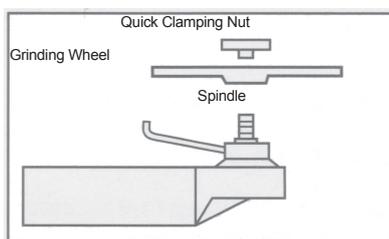

Model No.	Ø mm	Thikness mm	Thread
QCNM14	46,5	13,4	M14



RACSDSV1

RACSDSIH

Model No.	Style	Description	Packaging style	Weight g
RACSDSV1	BOSCH SDS+	To convert SDS and other direct drive systems to accept 1/2" x 20 female chuck for rotary only work Supplied complete with M6 left hand threaded retaining screw	Individual box	55
RACSDSV1B			Blister card	55
RACSDSMAKB	MAKITA		Blister card	50
RACSDSIH magnetic	BOSCH SDS+	To convert SDS system to accept tools with 1/4" hexagon shanks for rotary rotation work	Bulk	50
RACSDSIHB magnetic			Blister card	



Model No.	Description	Packaging style	Weight g
RACX1	1/4" DIN 3126 Form E 6,3 hexagon shank with 3/8" x 24 threaded mount	Bulk	20



Model No.	Description	Packaging style	Weight g
VSR10D5	M5 left hand thread spare screw total length 18 mm for use with 10 mm 3/8" x 24 threaded keyed chucks	Bulk	6
VSR10D6	M6 left hand thread spare screw total length 23 mm for use with 10 mm 1/2" x 20 threaded keyed chucks		
VSR13D6	M6 left hand thread spare screw total length 27 mm for use with SDS adaptors and 13 mm 1/2" x 20 threaded keyed chucks		



Model No.	Description	Packaging style	Weight g
RAC3812M	To convert 1/2" x 20 female to 3/8" x 24 male	Individual box	26
RAC3812MB		Blister card	
RAC3838M	To convert 3/8" x 24 female to 3/8" x 24 male	Individual box	19
RAC3838MB		Blister card	



Model No.	Description	Packaging style	Weight g
RAC3812F	To convert 1/2" x 20 female to 3/8" x 24 female	Individual box	11
RAC3812FB		Blister card	



Model No.	Description
RACX1SQ38B	1/4" hexagon adaptor to 3/8" square drive



Model No.	Description
RACX1WBHB	1/4" wobble type adaptor <ul style="list-style-type: none"> • locked: straight position • unlocked: wobble position up to 25°



Model No.	Description
RAC12SQ38B	Convert 1/2" x 20 thread to 3/8" square drive
RAC12SQ12B	Convert 1/2" x 20 thread to 1/2" square drive

Quick release 1/4" hexagon bit holders



Model No.	Description
RAC14HSQ14B	To be fitted on 1/4" square drive machine
RAC14HSQ38B	To be fitted on 3/8" square drive machine
RAC14HSQ12B	To be fitted on 1/2" square drive machine
RAC14HT38B	To be fitted on 3/8" x 24 threaded mount machine
RAC14HT12B	To be fitted on 1/2" x 20 threaded mount machine



Color ring bit set: 32 pcs 1/4" 25mm with magnetic bits holder

Model No.	Box description	Packaging	Weight g
CCBS32	4 pcs. PH: 1-2x2-3 4 pcs. PZ: 1-2x2-3 4 pcs. HEX: 3-4-5-6 mm 4 pcs. SLOTTED: 3-4-5-6 mm 7 pcs. TORX: T10-15-20-25-27-30-40 7 pcs. TORX TAMPER: T10-15-20-25-27-30-40 1 pcs. Adaptor 1 pcs. Magnetic bits holder - L 60mm	Transparent box	290



Color ring bit set: 32 pcs 1/4" 25mm with magnetic bits holder and gear wrench

Model No.	Box description	Packaging	Weight g
CCBS32R	4 pcs. PH: 1-2x2-3 4 pcs. PZ: 1-2x2-3 4 pcs. HEX: 3-4-5-6 mm 4 pcs. SLOTTED: 3-4-5-6 mm 7 pcs. TORX: T10-15-20-25-27-30-40 7 pcs. TORX TAMPER: T10-15-20-25-27-30-40 1 pcs. Stainless magnetic bits holder - L 60mm 1 pcs. Gear wrench with plastic handle - L 90mm	Transparent box	330

